


CC-1

TYPE MOLDS
Horizontal End to End
For AWG Conductors

| MOLDS FOR AWG CONDUCTORS | | | | | | | | | | |
|--------------------------|---------------------|-----------|-------------|---------------|-----------|-----------------------|-----------|------------|---------------|-----------|
| Cable | STANDARD CONNECTION | | | | | HEAVY DUTY CONNECTION | | | | |
| | Mold # | Price Key | Weld Metal* | Handle Clamps | Lead Time | Mold # | Price Key | Weld Metal | Handle Clamps | Lead Time |
| #8 | M-6021 | 4 | 15 | B-106 | 2 | M-6021-H | 4 | 32 | B-106 | 4 |
| #6 | M-200 | 4 | 25 | B-106 | 2 | M-200-H | 4 | 45 | B-106 | 4 |
| #4 | M-201 | 4 | 25 | B-106 | 2 | M-201-H | 4 | 45 | B-106 | 2 |
| #2 | M-203 | 4 | 32 | B-106 | 2 | M-203-H | 4 | 65 | B-106 | 2 |
| #1 | M-204 | 4 | 32 | B-106 | 4 | M-204-H | 4 | 65 | B-106 | 4 |
| 1/0 | M-205 | 4 | 45 | B-106 | 2 | M-205-H | 4 | 90 | B-106 | 2 |
| 2/0 | M-206 | 4 | 65 | B-106 | SDS | M-206-H | 4 | 115 | B-106 | 2 |
| 3/0 | M-207 | 4 | 90 | B-106 | 2 | M-207-H | 4 | 150 | B-106 | 2 |
| 4/0 | M-208 | 4 | 90 | B-106 | SDS | M-208-H | 4 | 150 | B-106 | 2 |
| 250 MCM | M-209 | 4 | 115 | B-106 | 2 | M-209-H | 4 | 200 | B-106 | 2 |
| 300 MCM | M-210 | 4 | 115 | B-106 | 2 | M-210-H | 4 | 200 | B-106 | 2 |
| 350 MCM | M-211 | 4 | 150 | B-106 | 2 | M-211-H | 4 | 250 | B-106 | 2 |
| 500 MCM | M-213 | 4 | 200 | B-106 | 2 | M-213-H | 5 | 2-150 | B-107 | 2 |
| 750 MCM | M-214 | 5 | 2-150 | B-107 | 2 | M-214-H | 5 | 500 | B-107 | 2 |
| 1000 MCM | M-215 | 5 | 2-200 | B-107 | 2 | M-215-H | 5 | 3-250 | B-107 | 4 |

Section 2 - Molds
AWG Conductors

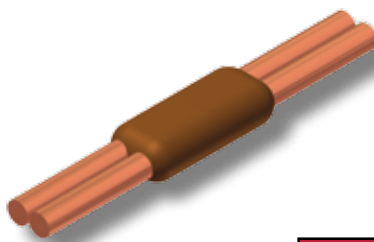

CC-14

TYPE MOLDS
Horizontal Parallel through Cables
For AWG Conductors

| MOLDS FOR AWG CONDUCTORS | | | | | | |
|--------------------------|-----|--------|-----------|------------|---------------|-----------|
| Cable | | Mold # | Price Key | Weld Metal | Handle Clamps | Lead Time |
| Run | Tap | | | | | |
| #8 | #8 | M-5709 | 18† | 15 | 40-4565-00 | 2 |
| #6 | #6 | M-5618 | 18† | 25 | 40-4565-00 | 2 |

- For sizes not listed, contact thermOweld®.
- Molds listed are for concentric stranded cable. Add suffix "-S" to mold number for solid conductors.
- For molds with wear plates, see page 135.
- For expedited service, contact thermOweld®.
- To order weld metal for use with EZ Lite Remote® insert TW before and EZ after weld metal number.
- Required Tools;
 - Handle Clamps w/ Flint Ignitor (see chart for correct handles)
 - 38-0309-00 ~ Flint Ignitor or 38-EZLT-RU ~ EZ Lite Remote®
 - † ~ Sold complete with handles
- Other recommended accessories;
 - 40-0319-01 ~ Mold Cleaner for cartridge sizes #15-#65
 - 40-0319-03 ~ Mold Cleaner for cartridge sizes #90-#500
 - 38-3922-00 ~ Mold Cleaning Brush
 - 38-0135-00 ~ Cable Cleaning Brush
 - 38-0330-00 ~ Cable Clamp