


MOLDS FOR METRIC CONDUCTORS					
Cable Size (mm ²)	Mold #	Price Key	Weld Metal	Handle Clamps	Lead Time
10	M-10038	4	15	B-106	2
16	M-10040	4	25	B-106	2
25	M-3004	4	32	B-106	2
30	M-2842	4	32	B-106	2
35	M-3005	4	32	B-106	2
50	M-3006	4	45	B-106	2
8 mm Ø	M-2849	4	45	B-106	2
70	M-3008	4	65	B-106	2
10 mm Ø	M-2910	4	65	B-106	2
95	M-3010	4	90	B-106	2
120	M-3011	4	115	B-106	2
150	M-3012	4	115	B-106	2
185	M-3013	4	150	B-106	2
240	M-3014	4	200	B-106	2
300	M-3015	4	250	B-106	2

CC-1 TYPE MOLDS


*Horizontal End to End
For Metric Conductors*

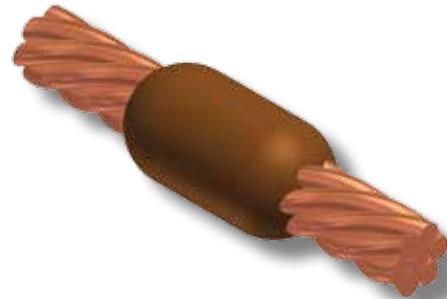

MOLDS FOR METRIC CONDUCTORS						
Cable (mm ²)		Mold #	Price Key	Weld Metal	Handle Clamps	Lead Time
Run	Tap					
10	10	M-10698	4	45	B-106	4
16	16	M-10699	4	65	B-106	4
25	25	M-10700	4	45	B-106	4
30	30	M-10701	4	45	B-106	4
35	35	M-10702	4	65	B-106	2
	25	M-10703	4	65	B-106	4
8 mm Ø	8 mm Ø	M-10704	4	90	B-106	4
50	50	M-10237	4	90	B-106	4
	35	M-3128	4	90	B-106	4
	25	M-10705	4	90	B-106	4
10 mm Ø	10 mm Ø	M-10706	4	115	B-106	4
70	70	M-4689	4	90	B-106	2
	50	M-10707	4	90	B-106	4
	35	M-10708	4	90	B-106	2
	25	M-10709	4	90	B-106	2
95	95	M-3126	4	200	B-106	4
	70	M-10710	4	150	B-106	4
	50	M-3127	4	150	B-106	4
120	35	M-10711	4	115	B-106	4
	120	M-8677	4	200	B-106	2
	95	M-10239	4	200	B-106	4
	70	M-10712	4	200	B-106	4
	50	M-10238	4	150	B-106	4

CC-14 TYPE MOLDS

*Horizontal Parallel through Cables
For Metric Conductors*

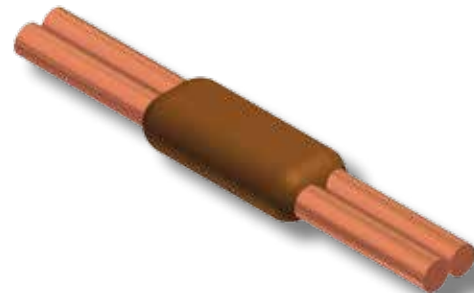

- For sizes not listed, contact thermOweld®.
- For heavy duty connections, contact thermOweld®.
- For molds with wear plates, see page 135.
- For expedited service, contact thermOweld®.
- To order weld metal for use with EZ Lite Remote® insert TW before and EZ after weld metal number.
- Required Tools;
 - Handle Clamps w/ Flint Ignitor (see chart for correct handles) 38-0309-00 ~ Flint Ignitor or 38-EZLT-RU EZ Lite Remote®
- Other recommended accessories;
 - 38-3922-00 ~ Mold Cleaning Brush
 - 38-0135-00 ~ Cable Cleaning Brush
 - 38-0330-00 ~ Cable Clamp