


CC-4

TYPE MOLDS

Horizontal to Horizontal Cable Cross
For Metric Conductors
Tap cable is cut

MOLDS FOR METRIC CONDUCTORS						
Cable (mm ²)		Mold #	Price Key	Weld Metal	Handle Clamps	Lead Time
Run	Tap					
10	10	M-10856	4	32	B-106	4
16	16	M-10782	4	45	B-106	2
25	25	M-3147	4	45	B-106	2
30	30	M-2926	4	45	B-106	4
35	35	M-3148	4	65	B-106	2
	25	M-3149	4	65	B-106	2
8 mm Ø	8 mm Ø	M-2950	4	90	B-106	2
50	50	M-3150	4	90	B-106	2
	35	M-3151	4	90	B-106	2
	25	M-3152	4	90	B-106	2
10 mm Ø	10 mm Ø	M-2928	4	115	B-106	2
70	70	M-3157	4	115	B-106	2
	50	M-3159	4	115	B-106	2
	35	M-3160	4	115	B-106	2
	25	M-3161	4	115	B-106	2
95	95	M-3167	4	150	B-106	2
	70	M-3169	4	150	B-106	2
	50	M-3171	4	115	B-106	2
	35	M-3172	4	115	B-106	2
120	120	M-3173	4	200	B-106	2
	95	M-3174	4	200	B-106	2
	70	M-3176	4	150	B-106	2
	50	M-3178	4	150	B-106	2
150	150	M-3179	4	250	B-106	2
	120	M-3180	4	250	B-106	2
	95	M-3181	4	200	B-106	2
	70	M-3183	4	150	B-106	2
185	185	M-3185	4	250	B-106	2
	150	M-3186	4	250	B-106	2
	120	M-3187	4	250	B-106	2
	95	M-3188	4	200	B-106	2
240	240	M-3191	5	500	B-107	2
	185	M-3192	5	2-200	B-107	2
	150	M-3193	5	2-200	B-107	2
	120	M-3194	5	2-150	B-107	2
300	300	M-3197	5	3-200	B-107	2
	240	M-3198	5	3-200	B-107	2
	185	M-3199	5	500	B-107	2
	150	M-3200	5	500	B-107	4
	120	M-3201	5	2-200	B-107	2
	95	M-3202	5	2-200	B-107	2

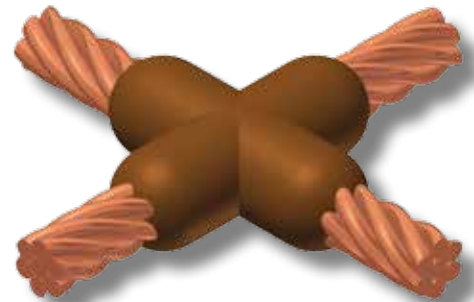

- For sizes not listed, contact thermOweld®.
- For heavy duty connections, contact thermOweld®.
- For molds with wear plates, see page 135.
- For expedited service, contact thermOweld®.
- To order weld metal for use with EZ Lite Remote® insert TW before andbEZ after weld metal number.
- Required Tools;
 - Handle Clamps w/ Flint Ignitor (see chart for correct handles) 38-0309-00 ~ Flint Ignitor or 38-EZLT-RU EZ Lite Remote®
- Other recommended accessories;
 - 40-0319-01 ~ Mold Cleaner for cartridge sizes #15-#65
 - 40-0319-03 ~ Mold Cleaner for cartridge sizes #90-#500
 - 38-3922-00 ~ Mold Cleaning Brush
 - 38-0135-00 ~ Cable Cleaning Brush
 - 38-0330-00 ~ Cable Clamp