


CC-7

TYPE MOLDS

Horizontal Parallel through Cables  
For AWG Conductors

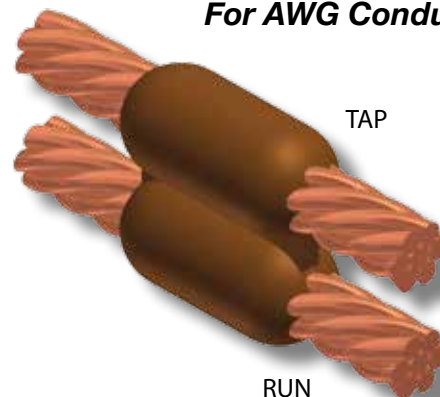

MOLDS FOR AWG CONDUCTORS						
Cable		Mold #	Price Key	Weld Metal	Handle Clamps	Lead Time
Run	Tap					
#6	#6	M-5965	4	25	B-106	2
#4	#4	M-1311	4	32	B-106	2
	#6	M-5627	4	32	B-106	2
	#6 Sol	M-8882	4	32	B-106	2
	#8	M-5629	4	32	B-106	4
#2	#8 Sol	M-5630	4	32	B-106	2
	#2	M-1313	4	65	B-106	2
	#2 Sol	M-6654	4	65	B-106	SDS
	#4	M-1314	4	65	B-106	2
	#6	M-5631	4	45	B-106	2
	#6 Sol	M-5632	4	45	B-106	2
	#8	M-5634	4	45	B-106	2
#1	#8 Sol	M-5635	4	45	B-106	4
	#1	M-1315	4	65	B-106	2
	#2	M-1316	4	65	B-106	2
	#4	M-1317	4	65	B-106	4
	#6	M-5636	4	65	B-106	4
	#6 Sol	M-5637	4	65	B-106	4
	#8	M-5638	4	45	B-106	4
1/0	#8 Sol	M-5639	4	45	B-106	4
	1/0	M-1318	4	90	B-106	2
	#1	M-1319	4	65	B-106	4
	#2	M-1320	4	65	B-106	2
	#4	M-1321	4	65	B-106	2
	#6	M-5642	4	65	B-106	2
	#6 Sol	M-1208	4	65	B-106	2
	#8	M-5644	4	65	B-106	4
#2 Sol	#8 Sol	M-5645	4	65	B-106	2
	#2	M-5973	4	65	B-106	4
2/0	2/0	M-1322	4	115	B-106	SDS
	1/0	M-1323	4	115	B-106	2
	#1	M-1324	4	90	B-106	2
	#2	M-1325	4	90	B-106	2
	#2 Sol	M-8289	4	90	B-106	4
	#4	M-5659	4	90	B-106	2
	#6	M-5342	4	90	B-106	2
	#6 Sol	M-5652	4	90	B-106	2
	#8	M-5668	4	65	B-106	4
	#8 Sol	M-5943	4	65	B-106	2
4/0	4/0	M-1331	4	200	B-106	SDS
	3/0	M-1332	4	200	B-106	2
	2/0	M-1333	4	150	B-106	2
	1/0	M-1334	4	150	B-106	2
	1/0 Sol	M-2551	4	150	B-106	4
	#1	M-1335	4	150	B-106	2
	#2	M-1336	4	150	B-106	2
	#2 Sol	M-6805	4	150	B-106	4
	#4	M-5340	4	150	B-106	2
	#6	M-5684	4	90	B-106	2
	#6 Sol	M-6552	4	90	B-106	2
	#8	M-5686	4	90	B-106	4
250 MCM	#8 Sol	M-5688	4	90	B-106	2
	250 MCM	M-1337	4	250	B-106	2
	4/0	M-1338	4	200	B-106	2
	2/0	M-1340	4	150	B-106	2
	1/0	M-1341	4	150	B-106	2
	#1	M-1342	4	150	B-106	4
	#2	M-1343	4	150	B-106	2

MOLDS FOR AWG CONDUCTORS						
Cable		Mold #	Price Key	Weld Metal	Handle Clamps	Lead Time
Run	Tap					
300 MCM	300 MCM	M-1344	5	2-150	B-107	2
	250 MCM	M-1345	4	250	B-106	4
	4/0	M-1346	4	200	B-106	2
	2/0	M-1348	4	150	B-106	4
	1/0	M-1349	4	150	B-106	2
	#1	M-1350	4	150	B-106	4
	#2	M-1351	4	150	B-106	4
350 MCM	350 MCM	M-1352	5	2-150	B-107	2
	300 MCM	M-1353	5	2-150	B-107	2
	250 MCM	M-1354	4	250	B-106	4
	4/0	M-1355	4	200	B-106	2
	2/0	M-1357	4	150	B-106	2
	1/0	M-1358	4	150	B-106	4
	#1	M-1359	4	150	B-106	4
500 MCM	#2	M-1360	4	150	B-106	2
	500 MCM	M-1371	5	2-200	B-107	2
	350 MCM	M-1373	5	2-150	B-107	2
	300 MCM	M-1374	5	2-150	B-107	2
	250 MCM	M-1375	4	250	B-106	2
	4/0	M-1376	4	200	B-106	2
	2/0	M-1378	4	150	B-106	2
	1/0	M-1379	4	150	B-106	2
	#1	M-1380	4	150	B-106	4
	#2	M-1381	4	150	B-106	2

- For sizes not listed, contact thermOweld®.
- Molds listed are for concentric stranded cable. Add suffix "-S" to mold number for solid conductors.
- For heavy duty connections, contact thermOweld®.
- For molds with wear plates, see page 135.
- For expedited service, contact thermOweld®.
- To order weld metal for use with EZ Lite Remote® insert TW before and EZ after weld metal number.
- Required Tools;
  - Handle Clamps w/ Flint Ignitor (see chart for correct handles) 38-0309-00 ~ Flint Ignitor or 38-EZLT-RU EZ Lite Remote®
- Other recommended accessories;
  - 40-0319-01 ~ Mold Cleaner for cartridge sizes #15-#65
  - 40-0319-03 ~ Mold Cleaner for cartridge sizes #90-#500
  - 38-3922-00 ~ Mold Cleaning Brush
  - 38-0135-00 ~ Cable Cleaning Brush
  - 38-0330-00 ~ Cable Clamp

Section 2 - Molds  
AWG Conductors